

Your Company Name

Email: companyemail@mail.com

Phone: 978-555-1504

YOUR LOGO



Customer Information

2252 Prytania Cir, Navarre, FL 32566




MyRoofReport



Copyright © Offsite Roof Reports, LLC – All Rights Reserved www.MyRoofReport.com | (603)305-1456

Offsite Roof Reports, LLC accepts no liability for the content of this report, or for the consequences of any actions taken on the basis of the information provided | Report for Planning Purpose only. This report was prepared from historical imagery. **Please have all Information provided verified before placing order for Materials.** Aerial Image provided as a client courtesy. Please use your professional expertise when applying waste factor. Waste factor does not account for treatment of hips and ridges | See Website Disclaimer for further details

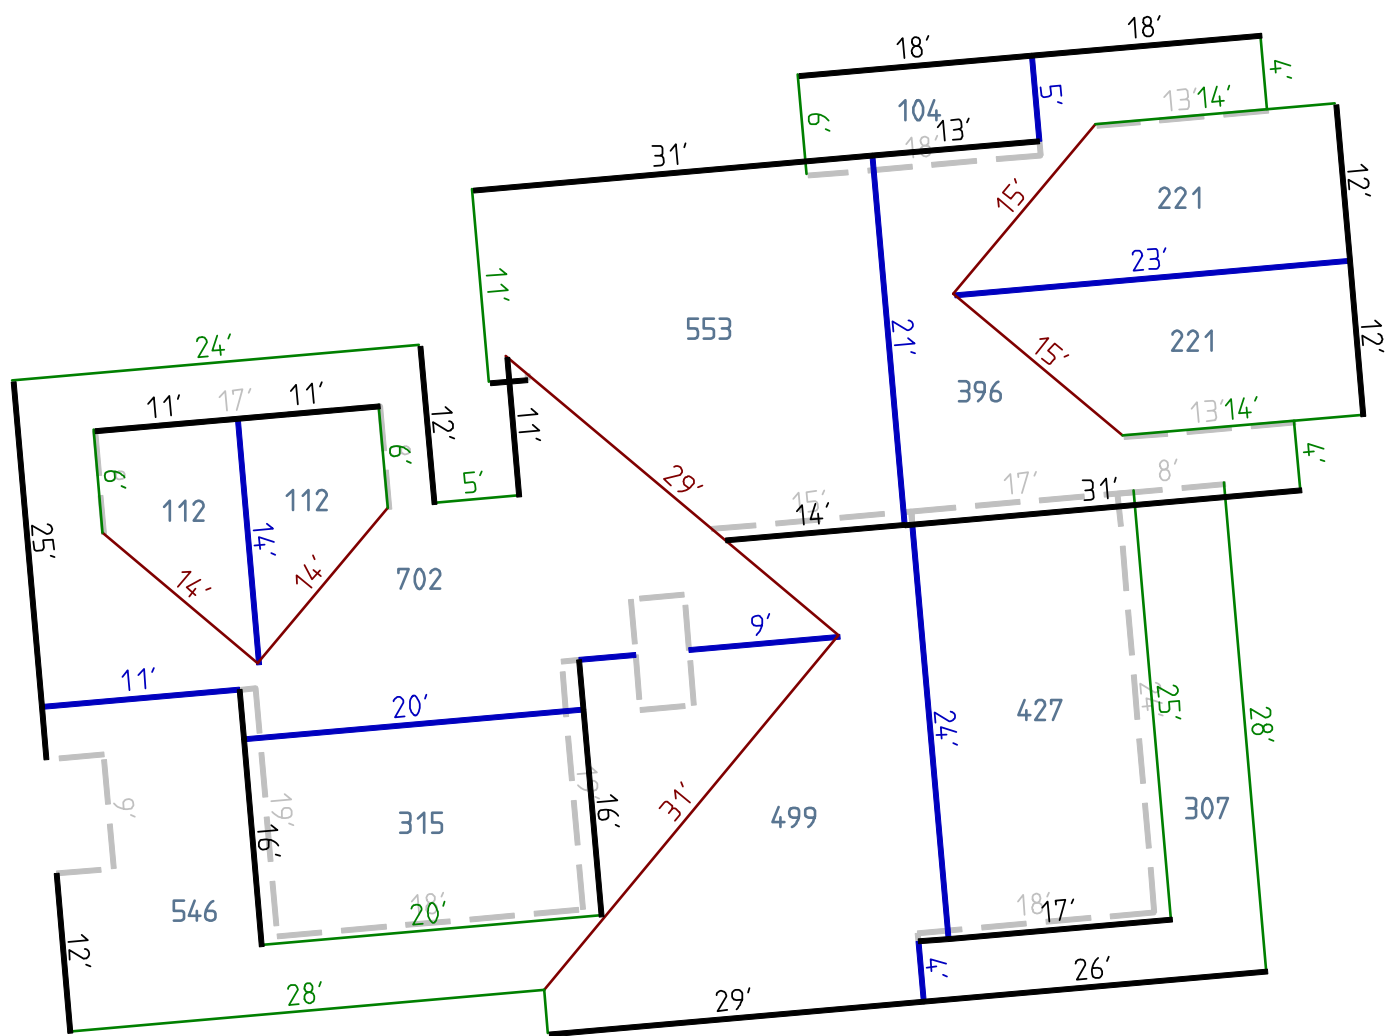

Entire Roof Pitch 10:12		Total Roof Squares = 45.07	
Waste Factor			
10%	15%	20%	25%
49.58	51.83	54.08	56.34

Total Roof Lengths

Ridge Length=134'

Valley Lengths=118'

Hip Length=0'

Eave Length=197'


Rake Length=350'

Perimeter (Eave + Gable)=547'

Transition Length=0'

Step Flashing=207'

Apron Flashing=52'

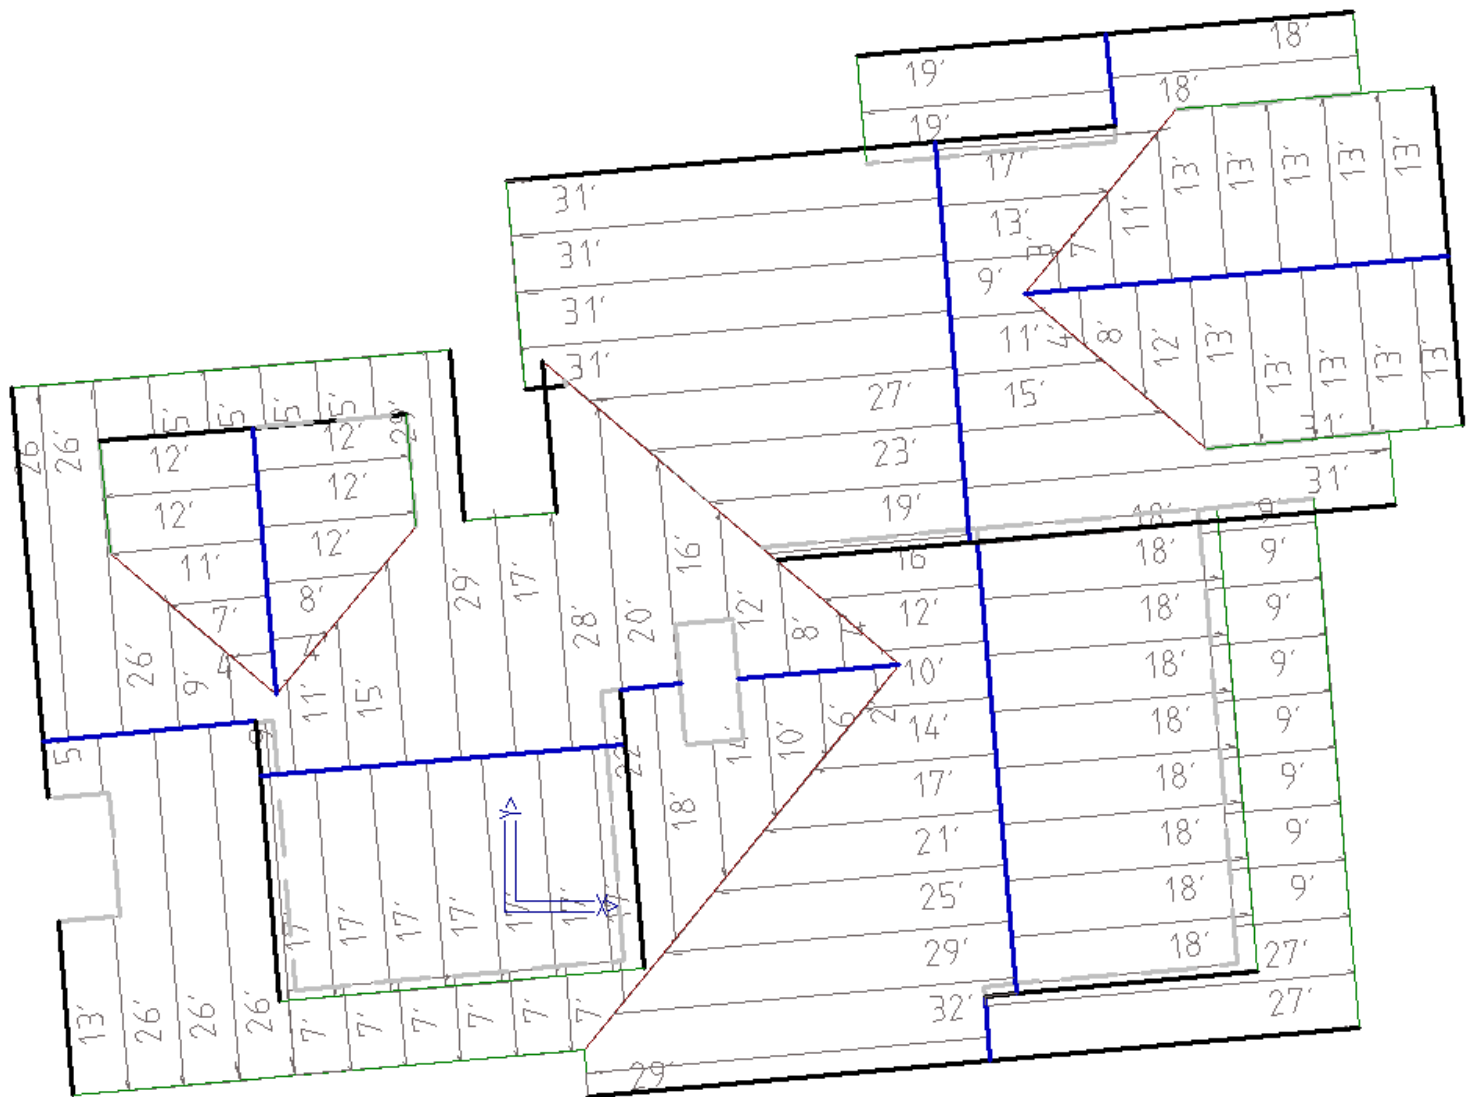

**NOT FOR
FABRICATION**

Standing Seam Metal Report	
Coverage Width	36"
Total Panel Length	1785'
Panel Area	53.52
Roof Area	45.07
Panel Area/Roof Area Estimated Waste	16%
(Please use your professional expertise when applying any waste factor)	
Standing Seam Panel Cut List	

1/32', 6/31', 4/29', 1/28', 3/27', 6/26', 1/25', 1/23', 1/22', 1/21', 1/20', 3/19', 12/18', 10/17', 2/16', 2/15', 2/14', 12/13', 8/12', 4/11', 2/10', 11/9', 3/8', 8/7', 1/6', 5/5', 4/4', 1/3', 1/2'
--